

Monitoring Data Record

Project Title: R-2552B Clayton Bypass COE Action ID: 200220745

Stream Name: Site 5 DWQ Number: 041760

City, County and other Location Information: US 70 Clayton Bypass from I-40 to US 70

Station 82+60 to 85+50 -L-

Date Construction Completed: 4/21/06

Monitoring Year: (2) of 5

Ecoregion: _____ 8 digit HUC unit 03020201

USGS Quad Name and Coordinates: _____

Rosgen Classification: _____

Length of Project: 410' Urban or Rural: Rural Watershed Size: _____

Monitoring DATA collected by: M. Green and J. Young Date: 6/19/08

Applicant Information:

Name: NCDOT Roadside Environmental Unit

Address: 1425 Rock Quarry Road Raleigh, NC 27610

Telephone Number: (919) 861-3772 Email address: mlgreen@dot.state.nc.us

Consultant Information:

Name: _____

Address: _____

Telephone Number: _____ Email address: _____

Project Status: Complete

Monitoring Level required by COE and DWQ (404 permit/ 401 Cert.): Level (1) 2 3

Monitoring Level 1 requires completion of *Section 1, Section 2 and Section 3*

Permit States: (200220745) NCDOT shall perform the following components of Level I monitoring twice each year for the 5 year monitoring period (summer and winter): Reference photos, plant survival, and visual inspection of channel stability. If less than two bankfull events occur during the first 5 years, NCDOT shall continue monitoring until the second bankfull event is documented. The bankfull events must occur during separate monitoring years. In the event that the required bankfull events do not occur during the 5-year monitoring period, the USACE, in consultation with resource agencies, may determine that further monitoring is not required.

(041760) Riparian vegetation reestablishment shall include a minimum of at least 2 native hardwood tree species planted at a density sufficient to provide 320 trees per acre at maturity. In addition, within one year proof shall be submitted that the riparian buffer has been restored and an annual report will be submitted for a period of 5 years showing that the trees and vegetation have survived and that the diffuse flow through the riparian buffer has been maintained. Failure to achieve the 320 trees per acre after 5 years will require reporting by DOT to DWQ. The report shall provide appropriate remedial actions to be implemented. Approval of the plan by the DWQ is required.

Section 1. PHOTO REFERENCE SITES

(Monitoring at all levels must complete this section)

Total number of reference photo locations at this site:

A total of 8 photos were taken from 4 photo point locations.

Dates reference photos have been taken at this site: 3/14/07, 7/16/07, 3/17/08, 6/19/08

Individual from whom additional photos can be obtained (name, address, phone): _____

Other Information relative to site photo reference: A site map is included with this report showing the photo point locations.

If required to complete Level 3 monitoring only stop here; otherwise, complete section 2.

Section 2. PLANT SURVIVAL

Attach plan sheet indicating reference photos.

Identify specific problem areas (missing, stressed, damaged or dead plantings):

Some planted vegetation is lacking where equipment was used to make some repairs along the streambank.

Estimated causes, and proposed/required remedial action: A supplemental planting should take place next fall.

ADDITIONAL COMMENTS: Planting was completed at this stream relocation in March 2007. The following planted species were found on the streambank: black willow and silky dogwood live stakes and in the buffer area: red oak, river birch, yellow poplar, and white oak bareroot seedlings. One 50 x 50 foot vegetation plot was set in the buffer area. An at-planting stem count was completed in March 2007. This gave an at-planting count of 26 planted stems in the vegetation plot. Year 2 Summer plant survival counts were conducted during June 2008 monitoring evaluation with the results showing an average density of 497 trees per acre, which is well above the minimum success criteria of 320 trees per acre. White oak trees were noted outside of the vegetation plot. Black willow and silky dogwood live stakes are surviving along the streambank. Other species noted on site included fennel, lespedeza, cattail, *Juncus* sp., sweetgum, wax myrtle, sedge, pine, wildflowers, alder, and various grasses. NCDOT will continue to monitor plant survival at this stream relocation.

If required to complete Level 1 and Level 2 monitoring only stop here; otherwise, complete section 3.

Plot #	Red Oak	River Birch	Yellow Poplar	White Oak	Total (2 year)	Total (at planting)	Density (Trees/Acre)
1	8	7	4		19	26	497
Average Density (Trees/Acre)							497

Section 3. CHANNEL STABILITY

Visual Inspection: The entire stream project as well as each in-stream structure and bank stabilization/revetment structure must be evaluated and problems addressed.

Report on the visual inspection of channel stability. Physical measurements of channel stability/morphology will not be required. Include a discussion of any deviations from as-built and an evaluation of the significance of these deviations and whether they are indicative of a stabilizing or destabilizing situation.

The stream relocation is stabilized for the Year 2 summer evaluation. The second cross vane upstream (Photo Point #4 Upstream) from the box culvert that was noted last monitoring evaluation with a slight headcut and water piping under the crossvane has been repaired. However, at time of monitoring water was piping under this cross vane. This may be due to low water flow at time of monitoring. NCDOT will continue to monitor channel stability at this stream relocation.

Date 6/19/08	Station Number 11+00 –S-	Station Number	Station Number	Station Number	Station Number
Structure Type	Crossvane				
Is water piping through or around structure?	Water is piping under crossvane				
Head cut or down cut present?					
Bank or scour erosion present?					
Other problems noted?					

NOTE: Attach separate narrative sheets to each monitoring report describing/discussing the overall monitoring results. Include the identification of specific problem areas/channel failures, estimated cause and proposed/required remedial action. This should include a brief discussion of any parameter that has changed significantly from as-built.

R-2552B Clayton Bypass



Photo Point #1 (Upstream)



Photo Point #1 (Downstream)



Photo Point #2 (Upstream)



Photo Point #2 (Downstream)



Photo Point #3 (Upstream)



Photo Point #3 (Downstream)

R-2552B Clayton Bypass



Photo Point #4 (Upstream)



Photo Point #4 (Downstream)

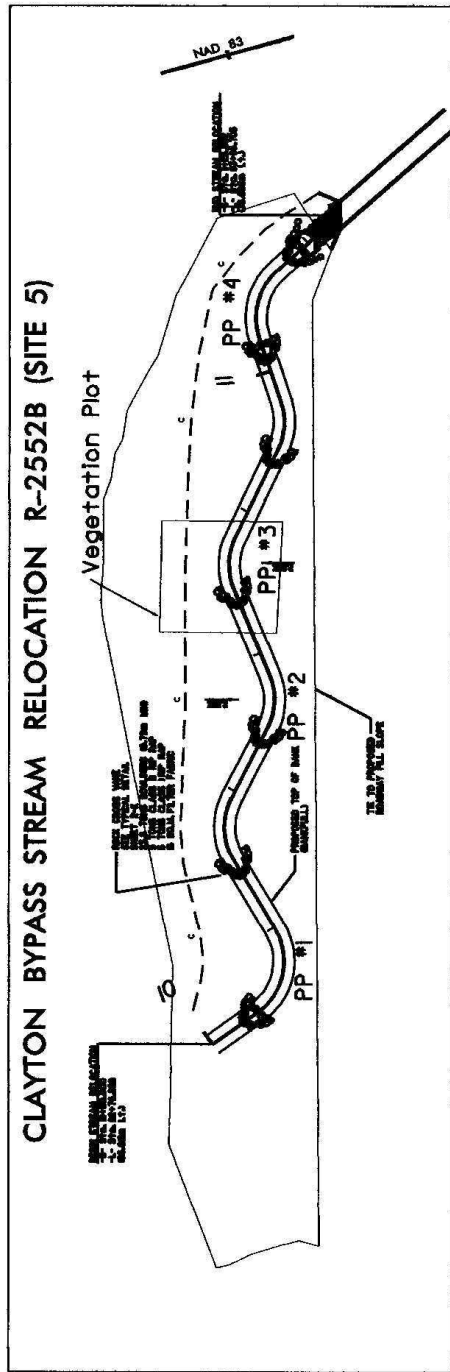
Year 2 Summer – Summer 2008



CLAYTON BYPASS STREAM RELOCATION R-2552B (SITE 5)

1 inch = 100 feet

Legend:

- Stream Channel
- Vegetation Plot
- PP #1, #2, #3, #4
- PP #3



		COUNT MP IN / INV	PROJECT INTEREST NO I-22213	1 / IN SHEET NO 2-4	PROJECT NO 2-4	PHYSICS ENGINEER